

MULTISPEC APPLICATION INSTRUCTIONS

1. SET UP VENTILATION.
2. SCRUB THE SURFACE WITH TUB & TILE CLEANER USING A 3M SCRUB PAD AND/OR 80GRIT WET OR DRY SANDPAPER.
3. RINSE WITH WATER.
4. DRY OFF SURFACE.
5. MASK OFF THE AREA.
6. TACK THE SURFACE.
7. SPRAY ON TWO LIGHT COATS CROSSLINK III.
8. MIX YOUR COLOR COORDINATED 2000 EPOXY PRIMER. MIX 4 PARTS 2000 EPOXY RESIN TO 1 PART 2000 EPOXY CATALYST. APPLY JUST UNTIL YOU ACHIEVE EVEN COVERAGE.
9. USING YOUR TURBINE AIR, BLOW THE 2000 EPOXY PRIMER UNTIL DRY TO TOUCH. APPROXIMATELY 2-3 MINUTES.
10. APPLY THE MULTISPEC... USE AN HVLP SPRAY GUN EQUIPPED WITH A 1.8mm – 2.2mm AIRCAP SET. APPLY THE MULTISPEC IN MULTIPLE LIGHT COATS ALLOWING MULTISPEC TO DRY 2-3 MINUTES BETWEEN COATS UNTIL YOU ACHIEVE DESIRED LOOK. **NOTE: IF YOU ARE USING THE PPS SYSTEM, BE SURE TO REMOVE THE SCREEN FILTER FROM THE PPS LID.**
11. ALLOW MULTISPEC TO DRY 45 MINUTES TO AN HOUR AND APPLY DESIRED CLEAR COAT. **NOTE: TO SPEED UP THE DRY TIME OF THE MULTISPEC, PLACE FANS IN THE ROOM AND FACE THEM TOWARDS YOUR PROJECT.**
12. ALLOW TO DRY APPROXIMATELY 20 MINUTES AND REMOVE MASKING.

FOR APPLICATION ASSISTANCE CONTACT GEORGE PICCOT AT: **803-316-6723**